


F1  **FASTON**
0.187" x 0.032"
quick disconnect tabs.

F2  **FASTON**
0.250" x 0.032"
quick disconnect tabs

FP  **FASTON POLARIZED**
Positive: "F2", Negative: "F1"

F1/0  4.8
21 0.6

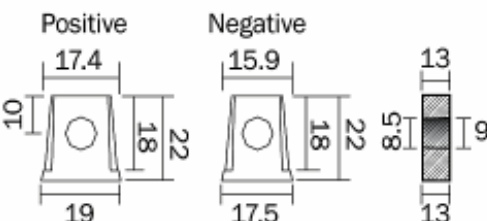
SP  **SPRING TERMINALS**
Fully collapsible positive
and negative contacts

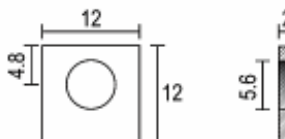
WL **INSULATED WIRE LEADS**
• Molex Housing 5264-02 &
5263-PBT plug on PS-605
• AMP Housing 1-480318-0 &
8116-1 on PS-1208

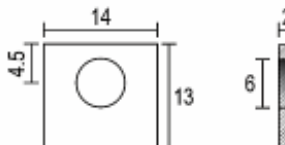
PC **PRESSURE CONTACTS**

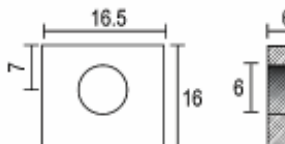
TH  **TOY BATTERY CONNECTORS**
H-connector PS-6120 TH

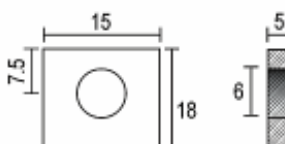
TS  **TOY BATTERY CONNECTORS**
S-connector PS-6120 TS

U  **Positive** **Negative**
17.4 15.9 13
10 18 22 18 22 9
19 17.5 13
Torque: 11.0~14.7 Nxm

NB1  12 12 4.8 5.6 2
Torque: 2.0~3.0 Nxm

NB2  14 13 4.5 6 2
Torque: 3.9~5.4 Nxm

NB3  16.5 16 7 6 6
Torque: 3.9~5.4 Nxm

NB4  15 18 7.5 6 5.5
Torque: 3.9~5.4 Nxm

B, T6 **THREADED INSERT - 6mm STUD**
16mm M6 6mm
Torque: 3.9~5.4 Nxm

T8 **THREADED INSERT - 6mm STUD**
20mm M6 6mm
Torque: 3.9~5.4 Nxm

T11 **THREADED INSERT - 8mm STUD**
20mm M8 7mm
Torque: 11.0~14.7 Nxm

T12 **THREADED INSERT - 5mm STUD**
12mm M5 6mm
Torque: 2.0~3.0 Nxm